

REGIONAL PROJECT MONITORING AND EVALUATION SYSTEM (RPMS)

PROJECT INSPECTION REPORT

As of March 2026 (Quarterly)

PMC: Eastern Samar

Name of Project/ Program Components	Location	Implementing Agency	Date of Project Inspection	Major Findings	Issues	Action Taken/ Recommendations
Construction of Farm-to-Market Road In Oras, Eastern Samar at Brgy. Dalid-Brgy. Bagacay	Brgy. Dalid, Oras, Eastern Samar	PLGU	25-Mar-26	1. Surface Irregularities/ Uneven Pavement 2. Corner Crack 3. Weakened Plane Joint 4. Animal footprints on Pavement Surface 5. Uncompacted Road Shoulder 6. Hairline Crack 7. Vegetation 8. Shoulder Erosion/ Soil Falling Off 9. Surface Scratched on pavement 10. Faded Sealant	1. Presence of surface irregularities 2. Presence of corner crack indicating localized structural distress 3. Deterioration of plane joint affecting load transfer efficiency 4. Surface deformities due to disturbance prior to concrete setting 5. Shoulder not properly compacted, prone to erosion and edge failure 6. Presence of hairline cracks with potential for water intrusion 7. Presence of vegetation along the road shoulder affecting maintenance and drainage condition. 8. Evident shoulder erosion and soil loss 9. Surface abrasion/scratches affecting pavement texture and durability 10. Faded joint sealant reducing effectiveness of water ingress protection	1. Undertake surface correction through grinding, reworking, or overlay 2. Apply appropriate crack sealing; consider slab replacement if necessary 3. Conduct joint resealing and repair of weakened sections 4. Monitor affected areas; undertake surface rectification if required. 5. Recompact and stabilize shoulder using suitable materials 6. Perform crack sealing to prevent further deterioration 7. Remove vegetation 8. Restore shoulder, install appropriate slope protection measures 9. Apply surface treatment or thin overlay as necessary 10. Reapply or replace joint sealant to ensure proper sealing

Submitted by:
 Designation/ Office:
 Date:

ENGR. SIXTO M. LIMBAUAN JR.
 PMC Chairman
 26-Mar-26

Inspected by:

ENGR. JERRY S. YAO
 LPMC Member
 ENGR. EDEN PAUL OCFEMIA
 LPMC Member

ENGR. LEMUEL NICART
 LPMC Member

ENGR. TRIXIE ANN B. AMOYAN
 LPMC Foral DILG ESPO

ARCH. ARNULFO B. DOTINGCO
 LPMC Member

ENGR. MARJORIE C. CAPONES
 Engineer II-DILG ESPO

Noted by: HON. RALPH VINCENT M. EDARDONE
 Governor



Scanned with CamScanner