



REGIONAL PROJECT MONITORING AND EVALUATION SYSTEM (RPMES)
PROJECT INSPECTION REPORT
 June 2026 (2nd Quarter)

PMC: JIPAPAD

Name of Project/ Program Components	Location	Implementing Agency	Date of Project Inspection	Major Findings	Issues	Action Taken/ Recommendations
Construction of Multi-Purpose Bldg (Child Development Center)	Brgy. Mabuhay	LGU-Jipapad	23-Jun-26	Lack of Project Billboard	Lack of Project Billboard	Advised the Contractor to install the Project Billboard ASAP
				Installed column tie bars are wide in dimension, resulting in insufficient concrete cover	non-compliance to the structural standard of having 40-50mm space from rebar to concrete column surface	Chip-off column surface and apply concrete plaster to provide adequate covering to nearly exposed rebars.
				Wide spacing of beam stirrups. Observed that spacing is 150mm	non-compliance to the approved plan indicating 100mm spacing of stirrups.	Advised the contractor to comply with the spacing of stirrups as indicated in the plan to be 100mm C.C.

Submitted by:
 Designation/ Office:
 Date:


RDSALYN L. BALACA
 PMC Chairperson

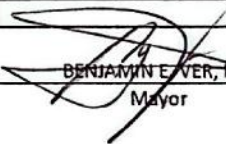Noted by: 
BENJAMIN E. VER, MD
 Mayor

Note: This is a new form based on the existing RPMES forms Adopted in 2015.